

576 STEP GENERATOR INTERMITTENTLY SKIPS STEPS

Manufacturing has found a problem in the 576 whereas the Step Generator would intermittently skip steps. To alleviate the situation, a Modification, M41067 was generated to install a capacitor, C-70 from U70, Pin 14 to ground (see illustration below). This mod was implemented by Manufacturing on all products starting at Serial Number B327878.

REPLACEABLE ELECTRICAL PARTS AND SCHEMATIC CHANGES


-

ADD:

C70 283-0110-00 CAP.,FXD,CER DI:0.005UF,+80-20%,150V

Add C70 from pin 14 of U70 to ground.

DIAGRAM  STEP GENERATOR

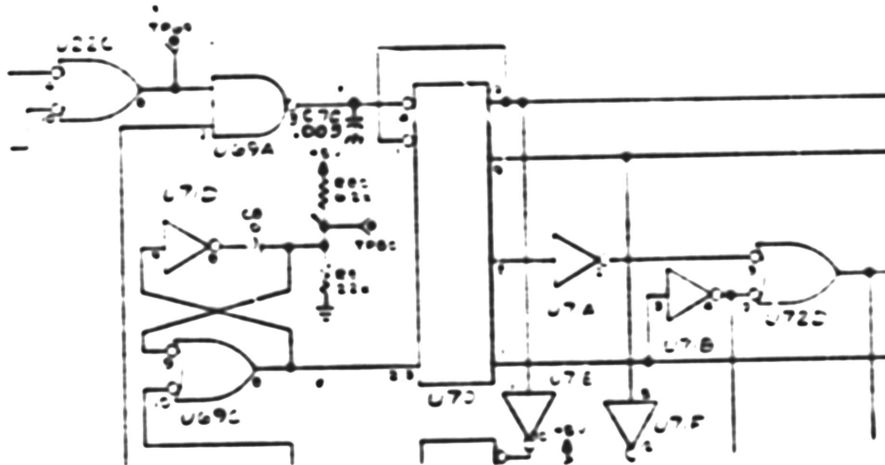

Inserted By:
Rich Andrusco
92-236, Ext. 1582
Aug. 1980

ISSUE 16-17